

CUSTOMER #: 34659

509362

MERCEDES-BENZ OF PALM BEACH
A New Country Motor Car Group Dealership



4000 Okeechobee Boulevard
WEST PALM BEACH, FLORIDA 33409

Mercedes-Benz

Telephone (561) 689-6363

INVOICE

MICHAEL APOSTOL
5675 SW RANCHITO ST
PALM CITY, FL 34990-5257
HOME: 914-489-4728 CONT:N/A

PAGE 1

FLORIDA REPAIR REG. NO. MV59108

BUS: CELL: 772-408-6132

SERVICE ADVISOR: 140 DAVE WEAVER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
SILVER	98	MER-BENZ 600SL-94	WDBFA76F1WF158833		50543/50545	T1067	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT97 DD			WAIT 08MAR12			CASH	08MAR12
R.O. OPENED	READY	OPTIONS: ENG:365_IN/5987_CC_Gas					
10:27 08MAR12	11:19 08MAR12						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT STATES THE CAR IS STARTING SLOW, CHECK BATTERY AND ADVISE BATTERY SDS TEST, MIDTRONICS TEST, KEY OFF DRAIN TEST, CHARGING SYSTEM TEST, REPLACE BATTERY

68	CPM					88.95	88.95
1	000-982-33-08 BATTERY				159.00	159.00	159.00
1	FLORIDA-LAW*BATT* WASTE FEE				1.50	1.50	1.50
PARTS:	160.50	LABOR:	88.95	OTHER:	0.00	TOTAL LINE A:	249.45

,,,50543 JCA1.60B MID FAILED=2J84-PQNG REPLACED BATTERY

B COURTESY EXTERIOR WASH AND VACUUM PASSENGER COMPARTMENT-\$10.95 VALUE-NO CHARGE

WASH COURTESY EXTERIOR WASH AND VACUUM PASSENGER COMPARTMENT-\$10.95 VALUE-NO CHARGE

68	C					0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE B:	0.00

SHOP SUPPLIES

7.12

PAID
VISA/MC AMEX CASH
CHECK#
MERCEDES-BENZ OF PALM BEACH

<p>LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint. Parts and labor are guaranteed for 12 months with unlimited mileage, excluding tune-ups and front end alignments.</p>	STATEMENT OF DISCLAIMER	DESCRIPTION	TOTALS
	The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.	LABOR AMOUNT	88.95
		PARTS AMOUNT	160.50
		GAS, OIL, LUBE	0.00
		SUBLET AMOUNT	0.00
		MISC. CHARGES	7.12
		TOTAL CHARGES	256.57
		LESS INSURANCE	0.00
	SALES TAX	15.40	
I ACKNOWLEDGE THAT ALL WARRANTY WORK HAS BEEN PERFORMED. CUSTOMER ACKNOWLEDGES RECEIPT OF COPY HEREOF.		PLEASE PAY THIS AMOUNT	271.97

SIGNED _____

CUSTOMER COPY

3422 S. Hwy 42
 P.O. Box 34480
 2882294

NAME _____ PHONE _____
 ADDRESS _____
 CITY, STATE, ZIP _____
 2ND AUTHORIZED NAME _____ PHONE _____

CUSTOMER'S INFORMATION
 RECEIVED (DATE & TIME) A.M. P.M. CUSTOMER'S ORDER NO. PROMISED (DATE & TIME) A.M. P.M.
 6/18/72
 YEAR • MAKE • MODEL 1960 Oldsmobile 5160
 LICENSE NO. _____ ODOMETER _____
 SERIAL #/VIN _____
 MOTOR # _____
 WRITTEN BY _____

QTY.	PART NO.	NAME OF PART	PRICE	WARRANTY YR.
		713 710	102.00	
		713 710	150.00	
		67704	19.20	
		FLUID	46.70	
		17000 210	71.00	
		706 30	96.30	

CHARGE FOR HAZARDOUS OR OTHER WASTE REMOVAL*
 Repair of 713 710 710 102.00
 7000 210 71.00
 706 30 96.30

METHOD OF PAYMENT:
 CHECK CHARGE CASH
 FLAT RATE HOURLY
 BOTH
 RETAIN PARTS DESTROY PARTS
 AUTHORIZED BY _____

LABOR
 DAILY STORAGE FEE AFTER REPAIR WORK HAS BEEN COMPLETED AND CUSTOMER HAS BEEN NOTIFIED. NO CHARGES SHALL ACCRUE OR BE PAID FOR A PERIOD OF 3 WORKING DAYS FROM DATE OF NOTIFICATION.

LABOR ONLY _____
 PARTS _____
 ACCESSORIES _____
 GAS, OIL & GREASE _____
 MISC. MERCHANDISE _____
 SUBLET REPAIRS _____
 STORAGE FEE _____
 TAX _____
TOTAL 271.50

MECHANICS RECOMMENDATIONS
 TOTAL PARTS _____
 Estimate Charge _____
 Basis for Charge _____

PLEASE READ CAREFULLY, CHECK ONE OF THE STATEMENTS BELOW AND SIGN:
 I UNDERSTAND THAT, UNDER STATE LAW, I AM ENTITLED TO A WRITTEN ESTIMATE, INCLUDING A COMPLETION DATE, IF MY FINAL BILL WILL EXCEED \$100. (\$50 in MD)
 I REQUEST A WRITTEN ESTIMATE. THE FINAL BILL MAY NOT EXCEED THIS ESTIMATE WITHOUT MY WRITTEN APPROVAL.
 I DO NOT REQUEST A WRITTEN APPROVAL.
 I DO NOT REQUEST A WRITTEN ESTIMATE.
 I DO NOT REQUEST A WRITTEN ESTIMATE, AS LONG AS THE REPAIR COSTS DO NOT EXCEED THE SHOP MAY NOT EXCEED THIS AMOUNT WITHOUT MY WRITTEN OR ORAL APPROVAL.

You are entitled by law to the return of all parts not used, except those for which there is a charge. Unless you agree otherwise by initialing the following, I do not return the return of any of the parts included during the authorized repair.
 Estimate good for 30 days. Not responsible for damage caused by theft, fire, or acts of nature. I authorize the above repairs, along with any necessary materials. I authorize you and your employees to operate my vehicle for the purpose of testing, inspection, and delivery at my risk. An express mechanic's lien is hereby acknowledged on the above vehicle to secure the amount of the repairs thereto. If I cancel repairs prior to their completion for any reason, a take-down and reassembly fee of \$ _____ will be applied.

SIGNED _____ DATE _____

*Checked lines apply (Preparer must check at least one):
 This charge represents costs and profits to the motor vehicle repair facility for miscellaneous shop supplies or waste disposal, which is required under _____ law.

AUTO REPAIR ORDER

Wilmington City Imports
 3442 Sw Armistead Ave
 P.O. Box 174 Ft 34950
 288-2748

NAME _____
 ADDRESS _____
 CITY, STATE _____

DATE 5/12/08 CUSTOMER'S ORDER NO. _____ WHEN PROMISED _____ PHONE _____
 YEAR • MAKE • MODEL Mercedes S600 SERIAL NO. _____ MOTOR NO. _____
 LICENSE NO. _____ ODOMETER _____ WRITTEN BY C

LUBE OIL CHANGE FLUSH TRANS. FLUSH DIFF. WASH POLISH

<p><i>Rep Plan New Oil Serv</i> <i>Amara (Pro Bay)</i> <i>Miss R...</i></p>		LABOR ONLY	
		PARTS	1770
ACCESSORIES		4210	
GAS, OIL, & GREASE			
GAS, OIL, & GREASE			
MISC MERCHANDISE			
SUBLET REPAIRS			
TOTAL ACCESSORIES			
TOTAL			642.20
TAX			79.20

QUAN.	PART NO.	NAME OF PART	PRICE
		<u>Oz Sensor</u>	<u>4250</u>
<p><i>PAID</i></p>			
<p>TOTAL PARTS _____</p>			
<p>MECHANICS RECOMMENDATIONS _____</p>			
<p>TOTAL GAS OIL & GREASE _____</p>			
<p>RETAIN PARTS _____ DESTROY PARTS _____</p>			
<p>AUTHORIZED BY _____</p>			
<p>ESTIMATE AMOUNT • PARTS & LABOR</p>			

YOU ARE ENTITLED TO A PRICE ESTIMATE FOR THE REPAIRS YOU HAVE AUTHORIZED. THE REPAIR PRICE MAY BE LESS THAN THE ESTIMATE, BUT IT CANNOT EXCEED THE ESTIMATE WITHOUT YOUR PERMISSION. YOUR SIGNATURE WILL INDICATE YOUR ESTIMATE SELECTION.

TEAR DOWN ESTIMATE - I UNDERSTAND THAT MY CAR WILL BE REASSEMBLED WITHIN _____ DAYS OF THE DATE SHOWN IF I CHOOSE NOT TO AUTHORIZE THE SERVICES RECOMMENDED.

1. Dealer or estimate is selling before you begin repair.
 2. Please proceed with repairs, but call me before arriving if the price will exceed \$ _____
 3. Do not start an estimate.

AUTO REPAIR ORDER

Kren Car Imports
 3442 Sw Annapolis Ave
 Annapolis, MD 21410
 288 2218

NAME: EC Ford
 ADDRESS: _____
 CITY, STATE: _____

DATE: 4/4/88
 YEAR * MAKE * MODEL: Mercury Sable
 LICENSE NO.: _____
 ODOMETER: _____
 WRITTEN BY: _____

CUSTOMER'S ORDER NO. _____
 WHEN PROMISED _____
 PHONE _____
 SERIAL NO. _____
 MOTOR NO. _____

LUBE OIL CHANGE FLUSH TRANS. FLUSH DIFF. WASH POLISH

Page 1 of 2
1017 Ford

QUAN.	PART NO.	NAME OF PART	PRICE
		OIL FIA	18.00
		OIL	67.00
			83.00
<p><i>(Handwritten signature)</i></p>			
<p>MECHANICS RECOMMENDATIONS</p>			
<p>TOTAL PARTS</p>			
<p>ESTIMATE AMOUNT - PARTS & LABOR</p>			

GAS, OIL & GREASE
 GALS. GAS _____
 QTS. OIL _____
 LBS. GREASE _____
 TOTAL GAS OIL & GREASE _____

RETAIN PARTS
 DESTROY PARTS

AUTHORIZED BY _____

LABOR ONLY
 PARTS _____
 ACCESSORIES _____
 GAS, OIL, & GREASE _____
 MISC. MERCHANDISE _____
 SUBLET REPAIRS _____

TAX _____
TOTAL 115.00

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH THE NECESSARY INTERNAL AND EXTERNAL PARTS AND LABOR. I AGREE TO PAY THE ESTIMATE TO YOU AND YOUR EMPLOYEES FOR THE REPAIR WORK. I UNDERSTAND THAT MY CAR WILL BE REASSEMBLED WITHIN THE TIME AMOUNT OF REPAIRS THEREIN. I REQUEST REPAIRS TO BE MADE WITHIN THE ESTIMATE. I REQUEST THAT YOU CONTACT ME AT THE ABOVE ADDRESS OR PHONE NUMBER TO CONFIRM THE REPAIRS. I REQUEST THAT YOU CONTACT ME AT THE ABOVE ADDRESS OR PHONE NUMBER TO CONFIRM THE REPAIRS. I REQUEST THAT YOU CONTACT ME AT THE ABOVE ADDRESS OR PHONE NUMBER TO CONFIRM THE REPAIRS.

ESTIMATE NO. _____
 DATE OF ESTIMATE _____

AUTO REPAIR ORDER

EUROPEAN CAR PERFORMANCE SERVICE, INC.

3135 SE SALERNO ROAD • STUART, FL 34997
 TEL (772) 221-4620 • FAX (772) 221-3915



Date 3/1/2007
 Invoice # 4680
 PO #
 Bar # MV-6537
 S/W

Customer Information:

Company
Customer ROBERT WEDER
Address 49 NORTH RIVER ROAD
 STUART, FL 34996

Home (772) 220-9615
Cell (772) 285-8005
Work
Ext

Vehicle Information:

Vehicle 1998 Mercedes Benz SL600
VIN # WDBFA76F1WF158833
License **Tag #**
Engine 6.0L V12 **Miles In** 40220
Trans Auto **Miles Out** 0

Vehicle Problem:

CHECK OIL LEAK

Recommendations:

TIRES WORN FR: 245/40ZR/18, RE: 275/35ZR/18. LEFT SIDE VALVE COVER GASKET SEEPING.

Parts Detail:

Part Number	Part Description	Qty	Item Price	Core	Ext. Price
1201800009	OIL FILTER	1	\$12.50	\$0.00	\$12.50
OILS	SYNTHETIC MOTOR OIL 5w40	10.6	\$3.50	\$0.00	\$37.10
1200140722	LOWER OIL PAN GASKET	1	\$85.00	\$0.00	\$85.00
2035400153	TRANSMISSION PLUG	1	\$65.00	\$0.00	\$65.00
ATFM	TRANSMISSION FLUID M/B	3	\$14.29	\$0.00	\$42.87

Labor Detail:

Type ID	Labor Description	Emp ID	Labor Costs
LABOR	REPLACE TRANSMISSION PLUG	CHIP	\$78.00
LABOR	REMOVE LOWER OIL PAN REPLACE O-RING ON OIL LEVEL SENSER	CHIP	\$312.00
OIL	CHANGE OIL, FILTER AND LUBE, 15PT CHECK	CHIP	\$39.00
LABOR	CHECK OIL LEAK	BOB	\$39.00

- I Request a Written Estimate
 I Do not request a Written Estimate as long as the Repair Cost does not exceed \$
 I DO NOT Request a written estimate

SIGNATURE: _____ DATE: ____/____/____

Parts and Labor are warranted for 10000 miles or 12 months, whichever comes first. This warranty is limited to the work mentioned on this form only and is not transferable. Vehicle must be returned to our workshop, at customers expenses, to honor warranty, warranty is void in case of misuse and/or neglect.

A Storage Fee of \$30.00 a day will be charged on all vehicles left over 48 hours after completion.

The Parts and Accessories sold and installed by this Repair Shop and the Service connected with the installation and adjustments of the Parts and Accessories sold and installed by this Repair Shop, are Guaranteed to be free from defects in material and workmanship under normal service and use until such Parts and Accessories have been driven, used, or operated for a distance of 10000 miles or a period of 10 months from date of Service, whichever first occurs, unless otherwise stated under the Part or service listed above. This repair shop is not responsible for the vehicle or contents in case of theft or fire.

I AUTHORIZE THE ABOVE STATED AGREEMENT INCLUDING THE ESTIMATED REPAIR PRICE. PLEASE SIGN BELOW.

Signature- Robert Weder

Parts Total \$242.47

Labor Total \$468.00
Hazard Waste \$3.02
Sublet \$0.00
Shop Supplies \$21.31
Subtotal \$734.80
Sales Tax \$46.18
Sales Tax 2 \$0.00
Work Order Total \$780.98
Total Payments \$0.00

Amount Due \$780.98

Thank You For Your Business!
 WWW.EUROPEANCARREPAIR.COM

Page 1 of 1

PAID: Full DATE: 3/2/07
 VISA 720-98

EUROPEAN CAR PERFORMANCE SERVICE, INC.

3135 SE SALERNO ROAD • STUART, FL 34997
 TEL (772) 221-4620 • FAX (772) 221-3915



Date 12/6/2006
 Invoice # 4162
 PO #
 Bar # MV-6537
 S/W

Customer Information:

Company Home (772) 220-9615
 Customer ROBERT WEDER Cell (772) 220-9436
 Address 49 NORTH RIVER ROAD Work
 STUART, FL 34996 Ext

Vehicle Information:

Vehicle 1998 Mercedes Benz S1600
 VIN # WDBFA76F1WF158833
 License Tag #
 Engine 6.0L V12 Miles In 38947
 Trans Auto Miles Out 0

Vehicle Problem:

ENGINE LIGHT ON, WINDSHIELD WASHER INOP. REPLACE HOOD PAD

Recommendations:

Parts Detail:

Part Number	Part Description	Qty	Item Price	Core	Ext. Price
2108690821	WASHER PUMP	1	\$65.00	\$0.00	\$65.00
1296802025	HOOD PAD	1	\$125.00	\$0.00	\$125.00
M3	ADHESIVE	1	\$15.00	\$0.00	\$15.00
0000781889	FUEL PRESSURE REGULATOR	1	\$195.00	\$0.00	\$195.00
FR8DPP33	SPARK PLUGS BOSCH PLATINUM	12	\$17.26	\$0.00	\$207.12

Labor Detail:

Type ID	Labor Description	Emp ID	Labor Costs
LABOR	REPLACE WASHER PUMP	RAL	\$42.50
LABOR	REPLACE HOOD PAD	RAL	\$85.00
LABOR	REPLACE FUEL PRESSURE REGULATOR	BOB	\$127.50
LABOR	REPLACE SPARK PLUGS	BOB	\$255.00

Sublet Detail:

Sublet Description	Total
FUEL S/U	\$35.00

- I Request a Written Estimate
 I Do not request a Written Estimate as long as the Repair Cost does not exceed \$
 I DO NOT Request a written estimate

SIGNATURE: [Signature] DATE: 12, 14, 06

Parts and Labor are warranted for 10000 miles or 12 months, whichever comes first. This warranty is limited to the work mentioned on this form only and is not transferable. Vehicle must be returned to our workshop, at customers expenses, to honor warranty, warranty is void in case of misuse and/or neglect.

A Storage Fee of \$30.00 a day will be charged on all vehicles left over 48 hours after completion.

The Parts and Accessories sold and installed by this Repair Shop and the Service connected with the installation and adjustments of the Parts and Accessories sold and installed by this Repair Shop, are Guaranteed to be free from defects in material and workmanship under normal service and use until such Parts and Accessories have been driven, used, or operated for a distance of 10000 miles or a period of 10 months from date of Service, whichever first occurs, unless otherwise stated under the Part or service listed above. This repair shop is not responsible for the vehicle or contents in case of theft or fire.

I AUTHORIZE THE ABOVE STATED AGREEMENT INCLUDING THE ESTIMATED REPAIR PRICE. PLEASE SIGN BELOW.

Signature- [Signature]

Parts Total \$607.12

Labor Total \$510.00
 Hazard Waste \$3.50
 Sublet \$35.00
 Shop Supplies \$33.51
 Subtotal \$1,189.13
 Sales Tax \$67.03
 Sales Tax 2 \$0.00
 Work Order Total \$1,256.16
 Total Payments \$0.00

Amount Due \$1,256.16

Thank You For Your Business!
 WWW.EUROPEANCARREPAIR.COM

Page 1 of 1

PAID: [Signature]
 AMT: [Signature] DATE: 12/14/06

EUROPEAN CAR PERFORMANCE SERVICE, INC.

3135 SE SALERNO ROAD • STUART, FL 34997
TEL (772) 221-4620 • FAX (772) 221-3915



Date 11/3/2006
Invoice # 4081
PO #
Bar # MV-6537
S/W

Customer Information:

Company
Customer ROBERT WEDER
Address 49 NORTH RIVER ROAD
STUART, FL 34996
Home (772) 220-9615
Cell (772) 220-9436
Work
Ext

Vehicle Information:

Vehicle 1998 Mercedes Benz S1600
VIN # WDBFA76F1WF158833
License **Tag #**
Engine 6.0L V12 **Miles In** 38016
Trans Auto **Miles Out** 0

Vehicle Problem:

CHECK ENGINE LIGHT ON.

Recommendations:

Parts Detail:

Part Number	Part Description	Qty	Item Price	Core	Ext. Price
LM2001	FUEL ADDITIVE	1	\$9.50	\$0.00	\$9.50
CHEMICAL	DECARBONIZER CHEMICAL	1	\$32.86	\$0.00	\$32.86

Labor Detail:

Type ID	Labor Description	Emp ID	Labor Costs
ENGINE	RETRIEVE FAULT CODES FOR ENGINE LIGHT, FROM ON CAR CUMPUTER DIAGNOSTIC (NO CHARGE) P0133	BOB	\$0.00
LABOR	CLEAN AND DECARBONIZE CATALYTHIC SYSTEM, CLEAR FAULT CODES AND RESET LIGHT.	BOB	\$170.00

- I Request a Written Estimate
 I Do not request a Written Estimate as long as the Repair Cost does not exceed \$
 I DO NOT Request a written estimate

SIGNATURE: Robert Weder DATE: 11/3/06

Parts and Labor are warranted for 10000 miles or 12 months, whichever comes first. This warranty is limited to the work mentioned on this form only and is not transferable. Vehicle must be returned to our workshop, at customers expenses, to honor warranty, warranty is void in case of misuse and/or neglect.

A Storage Fee of \$30.00 a day will be charged on all vehicles left over 48 hours after completion.

The Parts and Accessories sold and installed by this Repair Shop and the Service connected with the installation and adjustments of the Parts and Accessories sold and installed by this Repair Shop, are Guaranteed to be free from defects in material and workmanship under normal service and use until such Parts and Accessories have been driven, used, or operated for a distance of 10000 miles or a period of 10 months from date of Service, whichever first occurs, unless otherwise stated under the Part or service listed above. This repair shop is not responsible for the vehicle or contents in case of theft or fire.

I AUTHORIZE THE ABOVE STATED AGREEMENT INCLUDING THE ESTIMATED REPAIR PRICE. PLEASE SIGN BELOW.

Signature- Robert Weder

Parts Total	\$42.36
Labor Total	\$170.00
Hazard Waste	\$0.00
Sublet	\$0.00
Shop Supplies	\$6.37
Subtotal	\$218.73
Sales Tax	\$12.74
Sales Tax 2	\$0.00
Work Order Total	\$231.47
Total Payments	\$0.00
Amount Due	\$231.47

Thank You For Your Business !
WWW.EUROPEANCARREPAIR.COM

Page 1 of 1

PAID: VNA

AMT: Full DATE: 11/3/06

EUROPEAN CAR PERFORMANCE SERVICE, INC.

3135 SE SALERNO ROAD • STUART, FL 34997
TEL (772) 221-4620 • FAX (772) 221-3915



Date 6/9/2006
Invoice # 3479
PO #
Bar # MV-6537
SW

Customer Information:		Vehicle Information:	
Company	Home (772) 220-9615	Vehicle	1998 Mercedes Benz S1600
Customer ROBERT WEDER	Cell (772) 220-9436	VIN #	WDBFA76F1WF158833
Address 49 NORTH RIVER ROAD	Work	License	Tag #
STUART, FL 34996	Ext	Engine 6.0L V12	Miles In 37775
		Trans Auto	Miles Out 0

Vehicle Problem:	Recommendations:
INSTALL REAR LEFT TIRE CHECK ENGINE LIGHT ON	

Parts Detail:					
Part Number	Part Description	Qty	Item Price	Core	Ext. Price
13638	OXYGEN SENSOR	2	\$189.00	\$0.00	\$378.00

Labor Detail:			
Type ID	Labor Description	Emp ID	Labor Costs
ENGINE	RETRIEVE ENGINE LIGHT, FROM ON CAR CUMPUTER DIAGNOSTIC PO311 RH O-2 SENSOR. REC BOTH FRONT RESET CHECK	BRUCE	\$59.50
LABOR	REPLACE AS NECESSARY	RAL	\$212.50

I Request a Written Estimate
 I Do not request a Written Estimate as long as the Repair Cost does not exceed \$
 I DO NOT Request a written estimate

SIGNATURE: _____ DATE: ____/____/____

Parts and Labor are warranted for 10000 miles or 12 months, whichever comes first. This warranty is limited to the work mentioned on this form only and is not transferable. Vehicle must be returned to our workshop, at customers expenses, to honor warranty, warranty is void in case of misuse and/or neglect.

A Storage Fee of \$30.00 a day will be charged on all vehicles left over 48 hours after completion.

The Parts and Accessories sold and installed by this Repair Shop and the Service connected with the installation and adjustments of the Parts and Accessories sold and installed by this Repair Shop, are Guaranteed to be free from defects in material and workmanship under normal service and use until such Parts and Accessories have been driven, used, or operated for a distance of 10000 miles or a period of 10 months from date of Service, whichever first occurs, unless otherwise stated under the Part or service listed above. This repair shop is not responsible for the vehicle or contents in case of theft or fire.

I AUTHORIZE THE ABOVE STATED AGREEMENT INCLUDING THE ESTIMATED REPAIR PRICE. PLEASE SIGN BELOW.

Parts Total	\$378.00
Labor Total	\$272.00
Hazard Waste	\$0.20
Sublet	\$0.00
Shop Supplies	\$19.50
Subtotal	\$669.70
Discount	\$30.00
Sales Tax	\$39.00
Sales Tax 2	\$0.00
Work Order Total	\$678.70
Total Payments	\$0.00
Amount Due	\$678.70

Signature- _____

Thank You For Your Business !
WWW.EUROPEANCARREPAIR.COM

PAID: USA
AMT: Full DATE: 6.10.06

EUROPEAN CAR PERFORMANCE SERVICE, INC.

3135 SE SALERNO ROAD • STUART, FL 34997
TEL (772) 221-4620 • FAX (772) 221-3915



Date 1/20/2006
Invoice # 2748
PO #
Bar # MV-6537
S/W

Customer Information:

Company
Customer ROBERT WEDER
Address 49 NORTH RIVER ROAD
STUART, FL 34996
Home (772) 220-9615
Cell (772) 220-9436
Work
Ext

Vehicle Information:

Vehicle 1998 Mercedes Benz SL600
VIN # WDBFA76F1WF158833
License **Tag #**
Engine 6.0L V12 **Miles In** 36587
Trans Auto **Miles Out** 0

Vehicle Problem:

ENGINE LIGHT ON, FUEL LEVEL SENDER BLINKING, ANTENNA MAST INOP, REPAIR REARVIEW MIRROR.

Recommendations:

Parts Detail:

Part Number	Part Description	Qty	Item Price	Core	Ext. Price
0030946804	AIR FILTERS (2 REQ)	2	\$27.50	\$0.00	\$55.00
1298270298	ANTENNA SEAL	1	\$18.57	\$0.00	\$18.57
1408270001	antenna mast-mercedes FIBER	1	\$119.00	\$0.00	\$119.00
1295421117	FUEL SENDING UNIT	1	\$95.00	\$0.00	\$95.00
LM2001	FUEL SYSTEM VALVE CLEANER	2	\$8.57	\$0.00	\$17.14
Est	ANTENNA REPAIR KIT	1	\$85.00	\$0.00	\$85.00

Labor Detail:

Type ID	Labor Description	Emp ID	Labor Costs
ELEC	ELECTRICAL DIAGNOSTIC, RESET ENGINE LIGHT P0170	BOB	\$80.00
LABOR	REPLACE BOTH AIR FILTERS	BOB	\$40.00
LABOR	REPLACE FUEL SENDING UNIT	BOB	\$120.00
LABOR	REPAIR ANTENNA MOTOR	BOB	\$80.00
LABOR	REPAIR REARVIEW MIRROR	BOSS	\$80.00

I Request a Written Estimate
 I Do not request a Written Estimate as long as the Repair Cost does not exceed \$
 I DO NOT Request a written estimate

SIGNATURE: _____ DATE: 1/29/06

Parts and Labor are warranted for 10000 miles or 12 months, whichever comes first. This warranty is limited to the work mentioned on this form only and is not transferable. Vehicle must be returned to our workshop, at customers expenses, to honor warranty, warranty is void in case of misuse and/or neglect.

A Storage Fee of \$30.00 a day will be charged on all vehicles left over 48 hours after completion.

The Parts and Accessories sold and installed by this Repair Shop and the Service connected with the installation and adjustments of the Parts and Accessories sold and installed by this Repair Shop, are Guaranteed to be free from defects in material and workmanship under normal service and use until such Parts and Accessories have been driven, used, or operated for a distance of 10000 miles or a period of 10 months from date of Service, whichever first occurs, unless otherwise stated under the Part or service listed above. This repair shop is not responsible for the vehicle or contents in case of theft or fire.

I AUTHORIZE THE ABOVE STATED AGREEMENT INCLUDING THE ESTIMATED REPAIR PRICE. PLEASE SIGN BELOW.

Signature: _____

Thank You For Your Business !

WWW.EUROPEANCARREPAIR.COM

Page 1 of 1

Parts Total	\$389.71
Labor Total	\$400.00
Hazard Waste	\$1.10
Sublet	\$0.00
Shop Supplies	\$23.69
Subtotal	\$814.50
Sales Tax	\$47.38
Sales Tax 2	\$0.00
Work Order Total	\$861.88
Total Payments	\$0.00
Amount Due	\$861.88

AMT: Full DATE: 1/29/06

EUROPEAN CAR PERFORMANCE SERVICE, INC.

3135 SE SALERNO ROAD • STUART, FL 34997
 TEL (772) 221-4620 • FAX (772) 221-3915



Date 12/2/2005
 Invoice # 2513
 PO #
 Bar # MV-6537
 S/W

Customer Information:		Vehicle Information:	
Company	Home (772) 220-9615	Vehicle	1998 Mercedes Benz S1600
Customer ROBERT WEDER	Cell (772) 220-9436	VIN #	WDBFA76F1WF158833
Address 49 NORTH RIVER ROAD	Work	License	Tag #
STUART, FL 34996	Ext	Engine 6.0L V12	Miles In 0
		Trans Auto	Miles Out 0

Vehicle Problem:	Recommendations:
CHECK INTERMITTENT ROUGH RUNNING AT 10SEC COLD. , SUSPENSION LIGHT ON INTERMITTENT , CHECK FRONT SUSPENSION COMPL WHEN TURNING STRANGE NOISE.	

Parts Detail:					
Part Number	Part Description	Qty	Item Price	Core	Ext. Price
0025426916	BODY SENSOR	1	\$158.00	\$0.00	\$158.00
Est	GASKET	1	\$23.00	\$0.00	\$23.00
LM	FUEL ADDITIVE	2	\$8.57	\$0.00	\$17.14

Labor Detail:			
Type ID	Labor Description	Emp ID	Labor Costs
LABOR	DIAGNOSTIC	BOB	\$144.00
ALI	FOUR WHEEL ALIGNMENT	BOB	\$160.00
Est	REPLACE MUFFLER GASKET	BOB	\$144.00
LABOR	REPLACE SENSOR	BOB	\$104.00

I Request a Written Estimate
 I Do not request a Written Estimate as long as the Repair Cost does not exceed \$
 I DO NOT Request a written estimate

SIGNATURE: *Marlene Weder* DATE: 12, 2, 05

Parts and Labor are warranted for 10000 miles or 12 months, whichever comes first. This warranty is limited to the work mentioned on this form only and is not transferable. Vehicle must be returned to our workshop, at customers expenses, to honor warranty, warranty is void in case of misuse and/or neglect.

A Storage Fee of \$30.00 a day will be charged on all vehicles left over 48 hours after completion.

The Parts and Accessories sold and installed by this Repair Shop and the Service connected with the installation and adjustments of the Parts and Accessories sold and installed by this Repair Shop, are Guaranteed to be free from defects in material and workmanship under normal service and use until such Parts and Accessories have been driven, used, or operated for a distance of 10000 miles or a period of 10 months from date of Service, whichever first occurs, unless otherwise stated under the Part or service listed above. This repair shop is not responsible for the vehicle or contents in case of theft or fire.

I AUTHORIZE THE ABOVE STATED AGREEMENT INCLUDING THE ESTIMATED REPAIR PRICE. PLEASE SIGN BELOW.

Parts Total	\$198.14
Labor Total	\$552.00
Hazard Waste Sublet	\$0.50
Shop Supplies Subtotal	\$22.50
Sales Tax	\$45.01
Sales Tax 2	\$0.00
Work Order Total	\$818.15
Total Payments	\$0.00

Signature- *Marlene Weder*

Thank You For Your Business!
 WWW.EUROPEANCARREPAIR.COM

Amount Due **\$818.15**
 PAID: *50.00*
 Page 1 of 1
768.15

PAID: *VNA*
 AMT: *Full* DATE: *12/2/05*

EUROPEAN CAR PERFORMANCE SERVICE, INC.

MV # 06537

3135 SOUTH EAST SALERNO ROAD
STUART, FLORIDA 34997
(772) 221-4620
FAX: (772) 221-3915



REPAIR ORDER # 15307 P.O. #

Date 12/30/03

Cust No	2209615	Yr/Make	1998 MERCEDES
Name	WEDER, ROBERT	Model	SL600
Company		Mileage In	30207.0 Out 0.0
Address	49 N. RIVER ROAD	Plate No	FL <
City/St	STUART, FL 34998	Fleet No	
Home Phone	285-8005	VIN	WDBFA76F1WF158833
Work Phone	561-220-9436 Ext	Color	SILVER
		Add'l Info	245/40ZR/18 275/35ZR/18

Stated Problem: MOUNT AND BALANCE 4 TIRES, ALIGNMENT BRAKES FRONT

QTY	PART NAME	PART NUMBER	EACH	AMOUNT
4 TIRES (CUSTOMER SUPPLIED)				
4.00	VALVE STEMS	VLV	1.25	5.00
1.00	BRAKE PADS	0024201520	95.90	95.90
2.00	BRAKE ROTORS FRONT	1404211012	118.00	236.00
4.00	SENSORS FRONT	1405401217	2.03	8.12
1.00	BRAKE FLUID DOT 4	DOT	9.78	9.78
QTY	LABOR OPERATION	MECH	AMOUNT	
1.00	REMOVE/REPLACE FRONT BRAKE PADS AND ROTORS BLEED BRAKE SYSTEM	RAL	171.60	
1.00	MOUNT/BALANCE 4 TIRES (LOW PROFILE)	RAL	117.00	

Thank you for
visiting us.

Continued on Next Page

Additional Work:

Parts	354.80
Labor	405.60
Misc	10.00
Shop Sup	20.28
Hazd Wst	10.00
SubTotal	800.68
Tax	45.62

Please Read Carefully. Check one of the Statements below and Sign. I Understand that under State Law I am entitled to a Written Estimate. If my final Bill will exceed \$100

- I Request a Written Estimate
- I do not Request a Written Estimate as long as the Repair Cost does not exceed \$ _____.
The Shop may not exceed this amount without my approval.
- I do not Request a Written Estimate.

[Signature]
Signature

Date

TOTAL	846.30
AISC	- 30.00
	<u>816.30</u>

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control. Our limited warranty on parts and labor is 12 months or 10,000 miles (on our parts only) unless otherwise agreed upon. A daily charge of \$80.00 will begin (3) working days after notification of completion of repairs.

PAID: VISA

AMT: Full

DATE: 1/3/04

Save Parts

AUTHORIZATION: X _____

EUROPEAN CAR PERFORMANCE SERVICE, INC.

MV # 06537


3135 SOUTH EAST SALERNO ROAD
STUART, FLORIDA 34997
(772) 221-4620
FAX: (772) 221-3915



REPAIR ORDER # 15307

Customer: 2209615 WEDEF

Page 2

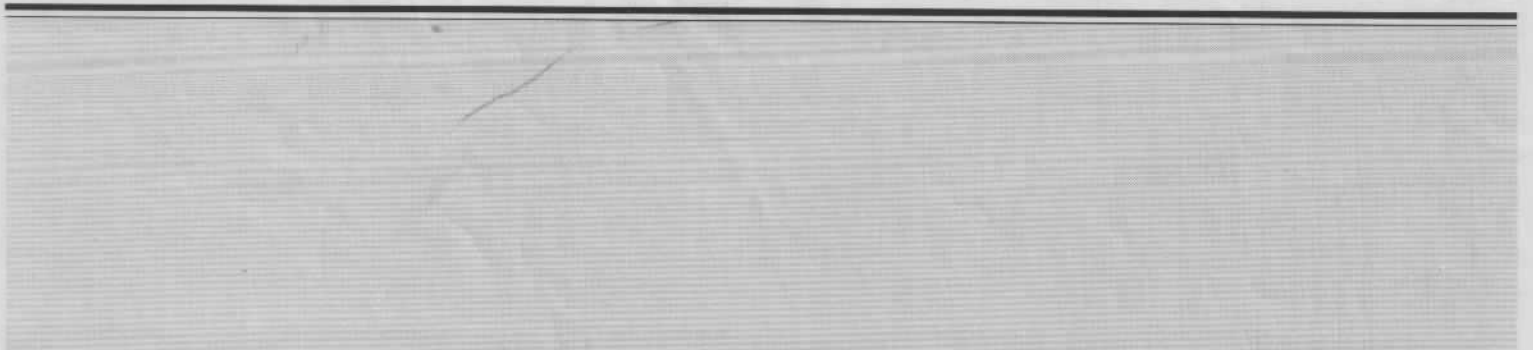

QTY	LABOR OPERATION	MECH	AMOUNT
1.00	FOUR WHEEL ALIGNMENT	RAL	117.00
QTY	MISCELLANEOUS ITEM		AMOUNT
4.00	DISPOSAL FEE		10.00

*Thank you for
visiting us.*

PAID: _____

AMT: _____ DATE: _____

EUROPEAN CAR PERFORMANCE SERVICE, INC.

MV # 06537

3135 SOUTH EAST SALERNO ROAD
STUART, FLORIDA 34997
(561) 221-4620
FAX: (561) 221-3915



Date 08/14/03

REPAIR ORDER # 177

P.O. #

Name	WEDER, ROBERT	Model	SL 600
Company		Mileage In	28000.0 Out 0.0
Address	49 N. RIVER ROAD	Plate No	FL <
City/St	STUART, FL 34996	Fleet No	
Home Phone	285-8005	VIN	WDBFA76F1WF158833
Work Phone	561-220-9436 Ext	Color	SILVER
		Add'l Info	245/40ZR/18 275/35ZR/18

Stated Problem: REPLACE INSULATION MAT. OIL SERVICE, ALIGNMENT.

QTY	PART NAME	PART NUMBER	EACH	AMOUNT
1.00	HOOD PAD	1296802025	88.06	88.06
1.00	ADHESIVE	UNIV	10.00	10.00
1.00	OIL FILTER	1201800009	11.00	11.00
10.70	SYNTHETIC OIL	20W50	6.50	69.55
1.00	WIPER BLADE INSERT 25"	4509	11.76	11.76
1.00	FUEL ADDITIVE	LM	6.30	6.30

QTY	LABOR OPERATION	MECH	AMOUNT
1.00	OIL SERVICE, INCLUDES 17 PT CHECK AND LUBRICATION	CHP	20.00
1.00	REMOVE OLD INSULATOR PAD, CLEAN SURFACE, REPLACE INSULATOR PAD.	CHP	78.00

Continued on Next Page

*Thank you for
visiting us.*

Additional Work: FRONT BRAKES DUE (MAX 1000MI). NEEDS SET OF 4 TIRES.

Please Read Carefully. Check one of the Statements below and Sign. I Understand that under State Law I am entitled to a Written Estimate. If my final Bill will exceed \$100

- I Request a Written Estimate
- I do not Request a Written Estimate as long as the Repair Cost does not exceed \$_____ The Shop may not exceed this amount without my approval.
- I do not Request a Written Estimate.

R. Weder 8/19/03
Signature Date

Parts	196.67
Labor	176.00
Misc	0.00
Shop Sup	8.80
Hazd Wst	7.87
SubTotal	389.34
Tax	23.45
TOTAL	412.79

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control. Our limited warranty on parts and labor is 12 months or 10,000 miles (on our parts only) unless otherwise agreed upon. A daily charge of \$80.00 will begin (3) working days after notification of completion of repairs.

PAID: V/S

AMT: Full DATE: 8.19.03

Save Parts

AUTHORIZATION: X _____

[Signature]

EUROPEAN CAR PERFORMANCE SERVICE, INC.

MV # 06537

3135 SOUTH EAST SALERNO ROAD
STUART, FLORIDA 34997
(561) 221-4620
FAX: (561) 221-3915



REPAIR ORDER # 177

Customer: 2209635



Page 2

Handwritten: 270011911 5/14/93

QTY	LABOR OPERATION	MECH	AMOUNT
1.00	FOUR WHEEL ALIGNMENT (TOE)	CHP	78.00

*Thank you for
visiting us.*

PAID: _____

AMT: _____ DATE: _____

Handwritten: 2209635

EUROPEAN CAR PERFORMANCE SERVICE, INC.

3135 SE SALERNO ROAD • STUART, FL 34997
 TEL (772) 221-4620 • FAX (772) 221-3915



Date 9/18/2007
 Invoice # 5446
 PO #
 Bar # MV-6537
 SW

Customer Information:		Vehicle Information:	
Company	Home (772) 220-9615	Vehicle	1998 Mercedes Benz S1600
Customer ROBERT WEDER	Cell (772) 285-8005	VIN #	WDBFA76F1WF158833
Address 49 NORTH RIVER ROAD STUART, FL 34996	Work (772) 341-4824	License	Tag #
	Ext	Engine 6.0L V12	Miles In 41028
		Trans Auto	Miles Out 0

Vehicle Problem:	Recommendations:
MOUNT AND BALANCE 4 TIRES, NITROGEN FILL. CHECK OIL LEAK (IN FRONT). CHECK ALIGNMENT.	

Parts Detail:					
Part Number	Part Description	Qty	Item Price	Core	Ext. Price
245/40R/18	TIRE MICHELIN PILOT (T-RACK)	2	\$0.00	\$0.00	\$0.00
275/35R/18	TIRE MICHELIN PILOT (T-RACK)	2	\$0.00	\$0.00	\$0.00
WEIGHT	WEIGHT SET PER TIRE	4	\$5.00	\$0.00	\$20.00
VLV	VALVE STEM	4	\$1.25	\$0.00	\$5.00
NIT	NITROGEN REFILL	5	\$10.00	\$0.00	\$50.00

Labor Detail:			
Type ID	Labor Description	Emp ID	Labor Costs
TMB	MOUNT AND BALANCE TIRES	RAL	\$212.50

Sublet Detail:		Total
Sublet Description		
TIRE DISPOSAL FEE (4)		\$20.00

I Request a Written Estimate
 I Do not request a Written Estimate as long as the Repair Cost does not exceed \$
 I DO NOT Request a written estimate

SIGNATURE: [Signature] DATE: 9/21/07

Parts and Labor are warranted for 10000 miles or 12 months, whichever comes first. This warranty is limited to the work mentioned on this form only and is not transferable. Vehicle must be returned to our workshop, at customers expenses, to honor warranty, warranty is void in case of misuse and/or neglect.

A Storage Fee of \$30.00 a day will be charged on all vehicles left over 48 hours after completion.

The Parts and Accessories sold and installed by this Repair Shop and the Service connected with the installation and adjustments of the Parts and Accessories sold and installed by this Repair Shop, are Guaranteed to be free from defects in material and workmanship under normal service and use until such Parts and Accessories have been driven, used, or operated for a distance of 10000 miles or a period of 10 months from date of Service, whichever first occurs, unless otherwise stated under the Part or service listed above. This repair shop is not responsible for the vehicle or contents in case of theft or fire.

I AUTHORIZE THE ABOVE STATED AGREEMENT INCLUDING THE ESTIMATED REPAIR PRICE. PLEASE SIGN BELOW.

Parts Total	\$75.00
Labor Total	\$212.50
Hazard Waste	\$0.80
Sublet	\$20.00
Shop Supplies	\$8.63
Subtotal	\$316.93
Sales Tax	\$18.69
Sales Tax 2	\$0.00
Work Order Total	\$335.62
Total Payments	\$0.00
Amount Due	\$335.62

Signature- [Signature]

Thank You For Your Business ! Page 1 of 1
 WWW.EUROPEANCARREPAIR.COM

PAID: [Signature]
 AMT: Full DATE: 9/28/07

Robert Weder

From: "The Tire Rack Team" <CustSvc@tirerack.com>
To: <R.WEDER@COMCAST.NET>
Sent: Saturday, September 15, 2007 2:47 PM
Subject: Order Confirmation



HOME

UPGRADE GARAGE

PRODUCTS

SHOPPING TOOLS

THANK YOU FOR SHOPPING AT THE TIRE RACK

Your order is currently being reviewed and processed. As soon as it leaves our warehouse you will receive a shipment confirmation via email as well.

Order Information

Customer Number: 1683105-000

Billing Address:
 WEDER, ROBERT
 49 N RIVER RD
 SEWALLS POINT, FL
 34996 6635
 (772) 285-8005

Shipping Address:
 WEDER, ROBERT
 EUROPEAN CAR
 PERFORMANCE (3)
 3135 SE SALERNO RD
 STUART, FL 34997 6645
 (772) 221-4620

Questions?

Please refer to your customer number at left and order number(s) below when calling.

Products & Shipping

If you have questions about the products you have ordered, please call RUDY-EXT 664 at 888-981-3953 or email rudy@tirerack.com

If you have questions about order status or other customer service matters, please contact customer service at 888-981-3953 or email custsvc@tirerack.com

Installation

Do you need help with installation? Select one of our [Recommended Installers](#) to handle your installation needs.

[Tire & Wheel Package installation instructions](#) are also available.

Rudy Ridell

Mileage:

Order Number: 4725163

Order Date: 09/15/07

Via: UPS GROUND

From: Georgia

PRODUCTS ORDERED

Qty	Size and Description	Availability	Price Each	Total Price
2	275/35ZR-18 Michelin Pilot Sport PS2 Mercedes <i>Back</i>	In Stock	\$307.00	\$614.00
1	Michelin Warranty Packet	In Stock	N/C	N/C
1	MAST Registration Card	In Stock	N/C	N/C
2	245/40ZR-18 Michelin Pilot Sport PS2 <i>Front</i>	In Stock	\$263.00	\$526.00
1	Michelin Warranty Packet	In Stock	N/C	N/C
1	MAST Registration Card	In Stock	N/C	N/C

VEHICLES

9/15/2007

Some products above selected for the following vehicle(s):

Vehicle: 98 Mercedes-Benz SL600

Shipping: \$45.61

Tax: \$0.00

Excise Tax: \$0.00

State Waste Tire Fund Fee: \$0.00

TRACK THIS ORDER

Order Total Including Shipping:\$1,185.61



Road Hazard Program may be available for these tires until 14 days from invoice date.

**Call 888-541-1777
for complete details.**

Tech Center



Every tire requires a break-in period for optimum performance. [Read more.](#)

7101 Vorden Parkway

• South Bend, IN 46628

• 888-541-1777

• www.tirerack.com

©1995-2006 TTR

If you have a question for our sales team please use this [contact form](#).

9/15/2007

51168

374659



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34982
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE
DUPLICATE 1
PAGE 1

SERVICE ADVISOR: 378 JOHN BOLOGNA

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES BENZ SL600R	WDBFA76F1WF158833	DN7HD	27870/27870	TR620	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	17:00 07JUL03		84.00	CASH	07JUL2003
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:YY ENG:12098312002495					
14:33 07JUL03	16:32 07JUL03	TRN:527581 AXL:4DR 1)R/C42362 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)					
LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	

A NO START BATTERY DEAD REPLACED BATTERY
4507 REPLACE BATTERY

499 CPM		0.00	0.00
1 004-541-45-01 BATTERY 100		109.00	109.00
1 BATTERY SURCHARGE		1.50	1.50

27870 BATTERY DEAD MB REPLACED THE BATTERY

B RO 3620 AUTH# 2388518
CAUSE: SIGN AND DRIVE - JUMPSTART
009100 ROAD SERVICE
499 WM93


(N/C)

27870 REQUESTED MB WENT ON ROADSIDE

* THIS CHARGE REPRESENTS COST AND PROFITS TO THE MOTOR VEHICLE REPAIR FACILITY FOR MISC. SHOP SUPPLIES OR WASTE DISPOSAL. FS403.718 MANDATES A \$1.00 FEE FOR EACH NEW TIRE SOLD IN THE STATE OF FLORIDA. FS403.7185 MANDATE \$1.50 FEE FOR EA NEW/USED BATTERY IN FL.

MV - 09852

Mercedes-Benz

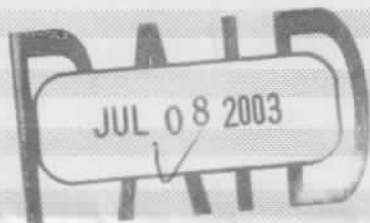

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	110.50
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	110.50
LESS INSURANCE	0.00
SALES TAX	7.18
PLEASE PAY THIS AMOUNT	117.68

CUSTOMER SIGNATURE

DATE

X

Where There is Service After the Sale

CUSTOMER COPY

51168

374660



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34982
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

PAGE 1

SERVICE ADVISOR: 378 JOHN BOLOGNA

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES BENZ SL600R	WDBFA76F1WF158833	DN7HD	27871/27871	TR622	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	17:00 07JUL03		84.00	CASH	07JUL2003

R.O. OPENED READY OPTIONS: STK:18106 DLR:YY ENG:12098312002495
 14:38 07JUL03 16:17 07JUL03 TRN:527581 AXL:4DR 1)R/C42362
 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)

LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A L/FRONT TIRE FLAT		INSTALL	SPARE			
CAUSE: SIGN AND DRIVE - JUMPSTART						
009100 ROAD SERVICE						
499 WM93						
						(N/C)

27871 REQUESTED MB WENT ON ROADSIDE

B RO# 3622 AUTH# 238435						
0001S SWAP ONE TIRE						
499 CPM						0.00
27871 TIRE FLAT MB INSTALED THE SPARE						0.00

* THIS CHARGE REPRESENTS COST AND PROFITS TO THE MOTOR VEHICLE REPAIR FACILITY FOR MISC. SHOP SUPPLIES OR WASTE DISPOSAL. FS403.718 MANDATES A \$1.00 FEE FOR EACH NEW TIRE SOLD IN THE STATE OF FLORIDA. FS403.7185 MANDATE \$1.50 FEE FOR EA NEW/USED BATTERY IN FL.
 MV - 09852



LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	0.00
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	0.00

CUSTOMER SIGNATURE DATE
 X

Where There is Service After the Sale
 CUSTOMER COPY

51168

401027



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34982
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME:561-220-9615 BUS:561-220-9436

INVOICE

PAGE 1

SERVICE ADVISOR: 4972 DAVID HOFFMAN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES BENZ SL600R	WDBFA76F1WF158833	DN7HD	33618/33621	T16	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT97	IS24SEP97	26OCT2001	16:00 09DEC04		92.00	CASH	09DEC2004
R.O. OPENED	READY	OPTIONS:					
		STK:18106 DLR:YY ENG:12098312002495					

17:31 07DEC04 15:56 09DEC04
 TRN:527581 AXL:4DR 1)R/C42362
 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)

LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A	C/S	ENG	MADE NOISE AND ACTED IF IT WAS RUNNING ON 11 CLYS THEN IT WENT AWAY AND IDLE NOW IS NOT AS SMOOTH AS IT WAS SEE DAVE			
			9989 DIAGNOSTIC CHARGES			
			683 CPM		92.00	92.00

33621 NONE AT THIS TIME 1.0 TEST DROVE - COULD NOT VARIIFY COMPLAINT ONLY SLIGHT ROUGHNESS @ IDLE DID ME FUEL INJECION CHECKS NO CODES STORED ALL ACTUAL VALUES APPEAR NORMAL NO FURTHER ACTION OR TESTS AT THIS TIME PER ADVISOR

B	COMPLIMENTARY CAR WASH					
	8570 COMPLIMENTARY CAR WASH					
	541 IWV					(N/C)

C	MODERN DENT REMOVAL					
	S191MDR MODERN DENT REMOVAL					
	999 CPM				0.00	0.00
	SUBL PO#56348					
	FC:				250.00	250.00

D**	C/S REPLACE S/PLUGS					
	1008 REPLACE SPARK PLUGS					
	683 CPM				248.40	248.40
	12 003-159-81-03 SPARK PLUG			15.60	15.60	187.20

33618 DUE 2.7 REPLACED SPARK PLUGS AS MAINT. ITEM NOT AS FIX FOR ANY PROBLEM

E**	C/S REPLACE BOTH M/MOUNTS					
	0502 REPLACE TWO ENGINE MOUNTS					
	683 CPM				506.00	506.00
	2 140-240-15-17 ENGINE MOUNT			189.15	189.15	378.30

33618 WORN/SAGGING 5.5 REPLACED MOTOR MOUNTS

F** C/S REPLACE ST/SHOCK		DESCRIPTION	TOTALS
LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		LESS INSURANCE	
		SALES TAX	
CUSTOMER SIGNATURE	DATE	PLEASE PAY THIS AMOUNT	

Where There is Service After the Sale
 CUSTOMER COPY

51168

401027



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34982
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME:561-220-9615 BUS:561-220-9436

INVOICE

PAGE 2

SERVICE ADVISOR: 4972 DAVID HOFFMAN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES BENZ SL600R	WDBFA76F1WF158833	DN7HD	33618/33621	T16	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT97	IS24SEP97	26OCT2001	16:00 09DEC04		92.00	CASH	09DEC2004
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:YY ENG:12098312002495					
17:31 07DEC04	15:56 09DEC04	TRN:527581 AXL:4DR 1)R/C42362					
2) PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)							

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

4021	REPLACE	STEERING	SHOCK				
		683	CPM			46.00	46.00
1	124-463-04-32	SHOCK	ABSORB		58.50	58.50	58.50

33618 LEAKING .5 REPLACED STEERING SHOCK

G** C/S REPLACE SHIFT LOCK CABLE HOUSING

2000	-----	TRANS/CLUTCH/DRIVE LINE-----					
		683	CPM			368.00	368.00
1	140-270-13-65	SHIFT	LINKAG		11.70	11.70	11.70
1	140-271-00-80	GASKET,	TRANS		6.44	6.44	6.44
6	001-989-21-03-10	TRANS	FLUID		9.36	9.36	56.16
1	140-277-00-95	TRANS	OIL FI		8.19	8.19	8.19
1	007603-010112	RING,	GENERAL		0.39	0.39	0.39
1	140-997-36-45	SEAL	RING,VL		0.98	0.98	0.98

33618 SHIFT LOCK CABLE HOUSING IN TRANSMISSION LEAKIN 4.0 REPLACED
TRANSMISSION SHIFT LOCK HOUSING INSIDE TRANSMISSION INSTALLED NEW
FILTER AND FLUID ALSO REPLACED MISSING SHIFTER BUSHING AT REAR OF SHIFT
LINKAGE

CUSTOMER PAY ENVIRONMENTAL * FOR REPAIR ORDER 20.00

* THIS CHARGE REPRESENTS COST AND PROFITS TO THE MOTOR VEHICLE REPAIR FACILITY FOR MISC. SHOP SUPPLIES OR WASTE DISPOSAL. FS403.718 MANDATES A \$1.00 FEE FOR EACH NEW TIRE SOLD IN THE STATE OF FLORIDA. FS403.7185 MANDATE \$1.50 FEE FOR EA NEW/USED BATTERY IN FL.
MV - 09852



LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.	DESCRIPTION	TOTALS
	LABOR AMOUNT	1260.40
	PARTS AMOUNT	707.86
	GAS, OIL, LUBE	0.00
	SUBLET AMOUNT	250.00
	MISC. CHARGES	20.00
	TOTAL CHARGES	2238.26
	LESS INSURANCE	0.00
	SALES TAX	145.49
	CUSTOMER SIGNATURE X	DATE

Where There is Service After the Sale
CUSTOMER COPY

51168

3 2 3 2 2 4



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34982
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

PAGE 1

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES BENZ SL600R	WDBFA76F1WF158833	DN7HD	16979/16979	T20	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	10:00 09OCT01		79.00	CASH	09OCT2001
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:YY ENG:12098312002495					
07:32 05OCT01	08:40 09OCT01	TRN:527581 AXL:4DR 1)R/C42362 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)					
LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	

A FLEXIBLE SERVICE SYSTEM (FSS) - SERVICE SCOPE "B"						
9009 PARTS INCLUDED IN SERVICE						
	790	IMP				(N/C)
	1	120-180-00-09	FILTER ELEME			(N/C)
	85	540	SYNTHETIC OIL			(N/C)
	1	129-835-00-47	FILTER,HVAC			(N/C)
	1	000-824-36-27-01	WINDSHIELD W			(N/C)
	1	001-986-44-71-10	CAR WASHING			(N/C)
	001100	FLEXIBLE SERVICE SYSTEM (FSS) - SERVICE SCOPE "B"				
	790	CPM			330.00	330.00
16979 FLEXIBLE SERVICE "B" PERFORM FLEXIBLE SERVICE "B"						

B REPLACE BRAKE FLUID						
9009 PARTS INCLUDED IN SERVICE						
	790	IMP				(N/C)
	1	000-989-08-07-10	BRAKE FLUID			(N/C)
	0041	REPLACE BRAKE FLUID				
	790	CPM			88.00	88.00
16979 REPLACE BRAKE FLUID 1.0 REPLACE BRAKE FLUID						

C REPLACE COOLANT						
9009 PARTS INCLUDED IN SERVICE						
	790	IMP				(N/C)
	1	Q-1-03-0002	ANTI-FREEZE			(N/C)
	0042	REPLACE COOLANT				
	790	CPM			87.00	87.00
16979 REPLACE COOLENT 1.0 REPLACE COOLENT						

D COMPLIMENTARY CAR WASH						
8570 COMPLIMENTARY CAR WASH						
	579	IWV				(N/C)
16979 WASH DONE						

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE **X** DATE

Where There is Service After the Sale
CUSTOMER COPY

51168

3 2 3 2 2 4



Motor Mall

4500 South U.S. 1 Fort Pierce, Fl 34982
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

PAGE 2

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES BENZ SL600R	WDBFA76F1WF158833	DN7HD	16979/16979	T20	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	10:00 09OCT01		79.00	CASH	09OCT2001
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:YY ENG:12098312002495					

07:32 05OCT01 08:40 09OCT01 TRN:527581 AXL:4DR 1)R/C42362
 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)

LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
E** (W)	COMPLAINT-AT	TIMES	PHONE FLAP	STICKS-HARD	TO OPEN	
CAUSE: STICKING						
68000001 REPOSITIONED PHONE FLAP						
790 WM93						(N/C)

16979 PHONE FLAP OUT OF ADJUSTMENT WARRANTY ADJUSTED AND LUBED FLAP

F** (W) (PO#61563) WHILE SERVICING TECH FOUND SUSPENSION SYSTEM
 FAULTY/HAS NO GIVE IN SUSPENSION-ROCK HARD

CAUSE: FAILED						
327280 ADS TROUBLE CODES AND DIAGNOSTIC TEST						
STEPS, CHECK						
790 WM93						(N/C)
2 129-320-01-15 HYDR.OIL CHA						(N/C)
2 140-328-05-15 AIR RESERVOI						(N/C)
2 124-997-09-40 SEAL RING,VL						(N/C)
2 000-989-91-03-10 P/S FLUID						(N/C)
2 007603-014106 RING,GENERAL						(N/C)
327300 ADS ELECTRICAL TEST PROGRAM, PERFORM AS						
NEC.						(N/C)
790 WM93						(N/C)
327330 ADS LEVEL CONTROL TEST PROGRAM, PERFORM						
790 WM93						(N/C)
327331 ADS HYDR. DAMPENING TEST PROGRAM, PERFORM						
790 WM93						(N/C)
327341 ADS HYDR. SYSTEM - FRONT, DEPRESSURIZE						
790 WM93						(N/C)
327342 ADS HYDR. SYSTEM - REAR, DEPRESSURIZE						
790 WM93						(N/C)
327400 ADS PRESSURE RESERVOIRS - LEFT & RIGHT						
FRONT, REPL.						(N/C)
790 WM93						(N/C)
327403 ADS PRESSURE RESERVOIRS - LEFT & RIGHT						

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE DATE
 X

Where There is Service After the Sale
 CUSTOMER COPY

51168

3 2 3 2 2 4



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34982
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

PAGE 3

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES BENZ SL600R	WDBFA76F1WF158833	DN7HD	16979/16979	T20	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	10:00 09OCT01		79.00	CASH	09OCT2001
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:YY ENG:12098312002495					
07:32 05OCT01	08:40 09OCT01	TRN:527581 AXL:4DR 1)R/C42362 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
			REAR, REPL.				
			790 WM93				(N/C)
	327350		ADS HYDRAULIC SYSTEM, BLEED				
			790 WM93				(N/C)

16979 FAULTY PRESSURE RESERVOIRES ADS TROUBLE CODES AND DIAGNOSTIC TEST
 FOUND 2 CODES-C1508 AND C1508 PERFORM ELECTRICAL test PERFORM ADS
 HYDR.DAMPNING TEST DEPRESSURISE FRONT DEPRESSURISE REAR REPLACE FRONT
 PRESSURE RESERVOIRES RIGHT AND LE REPL.REAR RIGHT AND LEFT PRESS.
 RESRVOIRS BLEAD SYSTEM RE TEST FOR CODES ROAD TEST OK

 G** (W) (PO#61563)WHILE SERVICING FOUND OIL LEAKING ONTOLEFT ENGINE PIPE
 CAUSE: LEAKIG
 015012 VALVE COVER - LEFT BANK, R & R / RESEAL
 790 WM93 (N/C)
 12 104-141-10-80 GASKET, INTAK (N/C)
 1 120-010-14-30 GASKET SET,C (N/C)

16979 LEFT VALVE COVER GASKET LEAKING R&R INTAKE MANIFOLD DRAIN COOLENT
 R&R RIGHT SIDE HEATER HOSE AT HEAD INSTALL NEW VALVE COVER GASKET
 REPLACE INTAKE MANIFOLD SEALS PRESS TEST COOLING SYSTEM CHECK FOR OIL
 LEAKS.OK3

 CUSTOMER PAY ENVIRONMENTAL * FOR REPAIR ORDER 15.00
 * GOVERNMENT REGULATIONS REQUIRE PROPER DISP-
 OSAL OF WASTE FROM SERVICING YOUR VEHICLE.
 THIS CHARGE REPRESENTS OUR ESTIMATED COST
 FOR ITEMS SUCH AS WASTE DISPOSAL AND/OR
 MISCELLANEOUS SHOP SUPPLIES RELATING TO
 THIS REPAIR ORDER.
 MV - 09852

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.	DESCRIPTION	TOTALS
	LABOR AMOUNT	505.00
	PARTS AMOUNT	0.00
	GAS, OIL, LUBE	0.00
	SUBLET AMOUNT	0.00
	MISC. CHARGES	15.00
	TOTAL CHARGES	520.00
	LESS INSURANCE	0.00
	SALES TAX	33.81
	CUSTOMER SIGNATURE X <i>Marianne Weder</i>	PLEASE PAY THIS AMOUNT

Where There is Service After the Sale
 CUSTOMER COPY

51168

291853



Motor Mall

4500 South U.S. 1 Fort Pierce, Fl 34954
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

PAGE 1

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES-BENZ SL600R	WDBFA76F1WF158833	GM790S	10966/10966	T5	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	15:00 13JUN00		72.00	CASH	13JUN2000
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:14345 ENG:12098312002495					
10:48 08JUN00	14:20 13JUN00	TRN:527581 AXL:4DR 1)R/C42362					
LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	
A	LOANER-VALET						

9100 LOANER CAR 305 RENTAL ACCOUNT
999 CPM

0.00 0.00

B (W) COMPLAINT-A/C NOT COOLING ENOUGH

CAUSE: LEAKING HOSE AND LEAKING EVAP

831520 CLIMATE CONTROL DIAGNOSIS VIA DTC, PERFORM
/ DETERM. COND.

631 WM93

(N/C)

1 AC-DYE UNIV A/C DYE

(N/C)

3 R134 R134A FREON

(N/C)

1 129-830-03-58 EVAPORATOR

(N/C)

1 140-830-04-84 EXPANSION VA

(N/C)

1 129-830-02-83 TANK

(N/C)

1 120-230-01-56 SUCTION LINE

(N/C)

3 140-997-06-45 SEAL RING, VL

(N/C)

2 140-997-07-45 SEAL RING, VL

(N/C)

2 140-997-08-45 SEAL RING, VL

(N/C)

2 140-997-09-45 SEAL RING, VL

(N/C)

2 140-997-11-45 SEAL RING, VL

(N/C)

1 129-830-01-03 HOUSING, HEAT

(N/C)

1 001-989-31-20 SEALING MATE

(N/C)

2 140-830-01-96 HOSE, WATER D

(N/C)

1 MISC PURE AIR

(N/C)

1 000-230-00-56 GASKET, SUCTI

(N/C)

831040 CLIMATE CONTROL (AUTOM.) FUNCTIONS TEST,
PERFORM

631 WM93

(N/C)

831047 CLIMATE CONTROL ELECTRIC TEST PROGRAM,
PERFORM

631 WM93

(N/C)

831585 A/C REFRIGERANT LEAK TEST, PERFORM

631 WM93

(N/C)

831534 A/C COOLING CAPACITY TEST, PERFORM

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE

DATE

X

Where There is Service After the Sale

CUSTOMER COPY

51168

291853



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34954
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

PAGE 2

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES-BENZ SL600R	WDBFA76F1WF158833	GM790S	10966/10966	T5	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	15:00 13JUN00		72.00	CASH	13JUN2000
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:14345 ENG:12098312002495					
10:48 08JUN00	14:20 13JUN00	TRN:527581 AXL:4DR 1)R/C42362 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
			631 WM93				(N/C)
	831762		A/C REFRIGERANT SYST., EVACUATE / CHARGE				(N/C)
			631 WM93				(N/C)
	837805		A/C TUBING/HOSE ASSEMBLY - CONDENSOR TO COMPRESSOR, REPL.				(N/C)
			631 WM93				(N/C)
	836523		A/C RECEIVER-DRIER, R & R / REPL. IF REQ.				(N/C)
			631 WM93				(N/C)
	836636		A/C EVAPORATOR, R & R / REPL. IF REQ.				(N/C)
			631 WM93				(N/C)
	833215		HEATER HOUSING ASSY. - AUTOMATIC OR TEMPMATIC A/C, R & R				(N/C)
			631 WM93				(N/C)

10966 EVAPORATOR AND COMPRESSOR HOSE LEAKING. WARR FUNCTION TEST, VERIFIED.// CONDUCTED COOLING CA CAP TESTS.// FOUND COMPRESSOR NOT ENGAGING.// CONDUCTED ELECTRICAL TESTS.// FOUND FREON LOW. // EVACUATED AND RECHARGE SYSTEM.// LEAK TRACED SYSTEM.// FOUND COMPRESSOR HOSE LEAKING, AND EVAPORATOR LEAKING.// REPLACED EVAPORATOR HIGH PRSSURE HOSE.//R&R DASH.// R&R HEATER BOX. // R&R COOLANT.// R&R HEAT EXCHANGER.// REPALCE EVAPORATOR.// REPLACED EXPANSION VALVE.// REPLACED RECEIVER DRIER.// EVACUATED AND AND CHARGED SYSTEM WITH 2.1 LBS R134A.// CHECKED COOLING CAP.// OK AT THIS TIME.

C COMPLIMENTARY CAR WASH
8570 COMPLIMENTARY CAR WASH
671 IWV (N/C)

10966 DONE

D** (W) SOP - INSTALL EMISSION LABEL - 1999120001
CAUSE: UPDATE - DAMAGE CODE# 54 910 36
022982 REPLACE IN-USE EMISSION STANDARD LABEL
631 WM93 (N/C)

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE

DATE

X

Where There is Service After the Sale

CUSTOMER COPY

51168

291853



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34954
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

PAGE 3

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES-BENZ SL600R	WDBFA76F1WF158833	GM790S	10966/10966	T5	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	15:00 13JUN00		72.00	CASH	13JUN2000
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:14345 ENG:12098312002495					
10:48 08JUN00	14:20 13JUN00	TRN:527581 AXL:4DR 1)R/C42362					
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	129-584-28-26	EMISSION LAB					(N/C)

10966 CAMPAIGN WARR INSTALLED LABEL FOR CAMPAIGN.

E** (W) (PO#62481) WHILE REPAIRING A/C EVAPORATOR, TECH FOUND BLOWER MOTOR HOUSING CLIP BROKEN

CAUSE: COMING APART

83000001 REPLACE BLOWER MOTOR HOUSING AND VACUUM ELEMENTS

631 WM93

2 129-988-14-78 CLIP

2 129-988-34-78 CLIP

1 001-800-10-75 VACUUM ELEME

(N/C)

(N/C)

(N/C)

(N/C)

10966 HEATER CASE, VACCUM ELEMENT COMING APART WARR WHILST REPAIRING EVAPORATOR.// DISCOVERED BLOWER MOTOR HOUSING COMING APART, AND VACUUM ELEMENT COMING APART.// REPLACED BLOWER MOTOR HOUSING.// REPLACED VACUUM ELEMENT .//OK AT THIS TIME.

* GOVERNMENT REGULATIONS REQUIRE PROPER DISPOSAL OF WASTE FROM SERVICING YOUR VEHICLE. THIS CHARGE REPRESENTS OUR ESTIMATED COST FOR ITEMS SUCH AS WASTE DISPOSAL AND/OR MISCELLANEOUS SHOP SUPPLIES RELATING TO THIS REPAIR ORDER.

MV - 09852



Thanks,
ARJ

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	0.00
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	0.00

CUSTOMER SIGNATURE

DATE

X

Where There is Service After the Sale

CUSTOMER COPY

51168

288190



Motor Mall

4500 South U.S. 1 Fort Pierce, Fl 34954
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

DUPLICATE 1
PAGE 1

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES-BENZ SL600R	WDBFA76F1WF158833	RDF73I	10082/10082	T53	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	10:00 14APR00		72.00	CASH	14APR2000
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:14345 ENG:12098312002495					
10:18 10APR00	09:33 14APR00	TRN:527581 AXL:4DR 1)R/C42362					
LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	
2) PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)							

A LOANER-WALK IN
9100 LOANER CAR 305 RENTAL ACCOUNT
999 CPM 0.00 0.00

B MOUNT & BALANCE 4 NEW TIRES (IN STOCK-SOP)
0004 REPLACE ALL TIRES AND MOUNTED AND BALANCED THEM
631 CPM 180.00 180.00
2 245/40ZR18 MICH TIRES PILOT 235.00 235.00 470.00
2 275/35ZR18 PILOT MICH TIRES 260.90 260.90 521.80

MISC FREIGHT IN.
CFRT 43.00 43.00

FC:
10082 18 INCH TIRES WORN OUT 2.5HRS R&R TIRES.// BROKE DOWN TIRES,
INSTALLED NEW TIRES.// SEATED BEADS.// BALANCED TIRES.// CONDUCTED ROAD
FORCE TESTS.// OK AT THIS TIME.

C COMPUTERIZED 4 WHEEL ALIGNMENT
0046 COMPUTERIZED 4 WHEEL ALIGNMENT
631 CPM 64.95 64.95

10082 TIRES WORN OUT 2.5HRS ALIGNED VEHICLE WITH HYDRAULIC SUSPENSION
AND 18 INCH TIRES.// NEC TO USE ADAPTORS ON ELECTRONIC HEADS.// OK AT
THIS TIME.

D COMPLIMENTARY CAR WASH
8570 COMPLIMENTARY CAR WASH
569 IWV (N/C)

10082 WASH VAC

F** (W(CAMPAIGN # 1999120001-E C I LABEL-1998 M.Y.
CAUSE: UPDATE- DAMAGE CODE# 54 910 36
022982 REPLACE IN-USE EMISSION STANDARD LABEL
631 WM93 (N/C)

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER SIGNATURE
X

DATE

Where There is Service After the Sale

CUSTOMER COPY

51168

2 8 8 1 9 0



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34954
(561) 466-7000 (800) 330-2044

MARY ANNE WEDER
ROBERT
49 N RIVER DRIVE
STUART, FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE

DUPLICATE 1
PAGE 2

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES-BENZ SL600R	WDBFA76F1WF158833	RDF73I	10082/10082	T53	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT1997	24SEP97	26OCT2001	10:00 14APR00		72.00	CASH	14APR2000
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:14345 ENG:12098312002495					
10:18 10APR00	09:33 14APR00	TRN:527581 AXL:4DR 1)R/C42362					
LINE OPCODE TECH TYPE HOURS		2) PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)		LIST	NET	TOTAL	

10082 ORDERED AIRBAG LABLE

G** REPLACE WIPER INSERT

5508 REPLACE WIPER INSERTS

999 CPM

0.00 0.00

1 000-824-36-27 WIPER RUBBER

10.84 10.84 10.84

* GOVERNMENT REGULATIONS REQUIRE PROPER DISP-
OSAL OF WASTE FROM SERVICING YOUR VEHICLE.
THIS CHARGE REPRESENTS OUR ESTIMATED COST
FOR ITEMS SUCH AS WASTE DISPOSAL AND/OR
MISCELLANEOUS SHOP SUPPLIES RELATING TO
THIS REPAIR ORDER.

MV - 09852

MERCEDES-BENZ

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	244.95
PARTS AMOUNT	1002.64
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	43.00
TOTAL CHARGES	1290.59
LESS INSURANCE	0.00
SALES TAX	81.09
PLEASE PAY THIS AMOUNT	1371.68

CUSTOMER SIGNATURE

DATE

X

Where There is Service After the Sale

CUSTOMER COPY

51168

247803



Motor Mall

4500 South U.S. 1 Fort Pierce, FL 34954
(561) 466-7000 (800) 330-2044

MARY ANN WEDER
ROBERT
49 N RIVER DRIVE
STUART FL 34997
HOME: 561-220-9615 BUS: 561-220-9436

INVOICE
DUPLICATE 1
PAGE 1

SERVICE ADVISOR: 272 FRED PATE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
744/SILVER	98	MERCEDES-BENZ SL600R	WDBFA76F1WF158833	RDF73I	2072/2074	T102	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
27OCT97	24SEP97	26OCT01	15:00 18MAR98		65.00	CASH	18MAR98
R.O. OPENED	READY	OPTIONS: STK:18106 DLR:14345 ENG:12098312002495					
07:46 18MAR98	11:50 18MAR98	TRN:527581 AXL:4DR 1)R/C42362 2)PHONEESN#12903804096 3)C/D# AL96NAV082 (More...)					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A OIL AND FILTER SERVICE							
9009 PARTS INCLUDED IN SERVICE							
							(N/C)
							(N/C)
							(N/C)
0039 OIL AND FILTER SERVICE							
						55.00	55.00
2072 PM .6 LOF COMPLETE							

B WASH AND VAC							
8570 WASH AND VAC							
							(N/C)
2072 .4 WASH VAC							

* GOVERNMENT REGULATIONS REQUIRE PROPER DISPOSAL OF WASTE FROM SERVICING YOUR VEHICLE. THIS CHARGE REPRESENTS OUR ESTIMATED COST FOR ITEMS SUCH AS WASTE DISPOSAL AND/OR MISCELLANEOUS SHOP SUPPLIES RELATING TO THIS REPAIR ORDER.
MV - 09852

MERCEDES-BENZ

LIMITED WARRANTY: The only warranties applying to the part(s) installed in accordance with this estimate are those that may be offered by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of products or service sold under the terms of this estimate. Parts and labor are guaranteed for 12 months or 12,000 miles, whichever comes first. Seller does not guarantee that the work performed in accordance with this estimate will correct any problem specified on the description of the complaint.

DESCRIPTION	TOTALS
LABOR AMOUNT	55.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	55.00
LESS INSURANCE	0.00
SALES TAX	3.58
PLEASE PAY THIS AMOUNT	58.58

CUSTOMER SIGNATURE
X

DATE

Where There is Service After the Sale

CUSTOMER COPY